

# Scenix Fluorescent Paint Process



All paints and clears for this process are neutral, lacking a blue hue shift that affects fluorescent paints. The result is a cleaner, brighter chroma of the fluorescent color's hue.

BASE WHITE:			
Mix 7131 Scenix UV White 1:1 7132 Scenix Mix White			
STEP 1	Additive	4016 Cross-Linker	<ul style="list-style-type: none"> <li>• 2% per volume</li> </ul>
STEP 2	Dilutant	4012	<ul style="list-style-type: none"> <li>• Add 2-10% per volume</li> <li>• Mix thoroughly for 1 minute &amp; wait 10 minutes to acclimate before using</li> </ul>
STEP 3	Apply	3 coats	<ul style="list-style-type: none"> <li>• Allow each coat enough time to dry matte &amp; tack free</li> <li>• Re-coat times approximately 5-15 minutes</li> </ul>
MID-COAT:			
Fluorescent Color			
STEP 1	Additive	4016 Cross-Linker	<ul style="list-style-type: none"> <li>• 2% per volume</li> </ul>
STEP 2	Dilutant	4012	<ul style="list-style-type: none"> <li>• Add 2-10% per volume</li> <li>• Mix thoroughly for 1 minute &amp; wait 10 minutes to acclimate before using</li> </ul>
STEP 3	Apply	3 coats	<ul style="list-style-type: none"> <li>• Allow each coat enough time to dry matte &amp; tack free</li> <li>• Re-coat times approximately 5-15 minutes</li> </ul>
TOP-COAT:			
SSR Clear			
STEP 1	Additive	4015 Cross-Linker	<ul style="list-style-type: none"> <li>• 2% per volume</li> </ul>
STEP 2	Dilutant	4011	<ul style="list-style-type: none"> <li>• Add 2-10% per volume</li> <li>• Mix thoroughly for 1 minute &amp; wait 10 minutes to acclimate before using</li> </ul>
STEP 3	Apply	3 coats	<ul style="list-style-type: none"> <li>• Allow each coat enough time to dry matte &amp; tack free</li> <li>• Re-coat times approximately 5-15 minutes</li> <li>• OK to handle in 2-3 hours</li> <li>• Final cure approximately 48 hours after application</li> </ul>



PO Box 120, 14 Airport Park Rd | East Granby, CT 06026  
800.243.2712 | 860.653.5505 | createxcolors.com